

มาตรฐานผลิตภัณฑ์อุตสาหกรรม

THAI INDUSTRIAL STANDARD

มอก. 2457 เล่ม 3 – 2552

ISO 6157-3 : 1988

ตัวยึด - รอยความไม่ต่อเนื่องที่ผิว

เล่ม 3 สลักเกลียว หมุดเกลียวและสลักเกลียวปล่อยสองข้างสำหรับใช้งานพิเศษ

FASTENERS - SURFACE DISCONTINUITIES

PART 3 : BOLTS, SCREWS AND STUDS FOR SPECIAL REQUIREMENTS

สำนักงานมาตรฐานผลิตภัณฑ์อุตสาหกรรม

กระทรวงอุตสาหกรรม

ICS 21.060.10

ISBN 978-974-292-966-4

มาตรฐานผลิตภัณฑ์อุตสาหกรรม
ตัวยึด - รอยความไม่ต่อเนื่องที่ผิว

เล่ม 3 สลักเกลียว หมุดเกลียวและสลักเกลียวปล่อยสองข้าง
สำหรับใช้งานพิเศษ

มอก. 2457 เล่ม 3-2552

สำนักงานมาตรฐานผลิตภัณฑ์อุตสาหกรรม
กระทรวงอุตสาหกรรม ถนนพระรามที่ 6 กรุงเทพฯ 10400
โทรศัพท์ 0 2202 3300

ประกาศในราชกิจจานุเบกษา ฉบับประกาศและงานทั่วไป เล่ม 127 ตอนพิเศษ 70 ง
วันที่ 4 มิถุนายน พุทธศักราช 2553

มาตรฐานผลิตภัณฑ์อุตสาหกรรมกำหนดขึ้นโดยรับ ISO 6157-3:1988 Fasteners – Surface discontinuities – Part 3: Bolts, screws and studs for special requirements มาใช้ในระดับเหมือนกันทุกประการ (identical) โดยใช้ ISO ฉบับภาษาอังกฤษเป็นหลัก

คณะกรรมการมาตรฐานผลิตภัณฑ์อุตสาหกรรมได้พิจารณามาตรฐานนี้แล้ว เห็นสมควรเสนอรัฐมนตรีประกาศตาม มาตรา 15 แห่งพระราชบัญญัติมาตรฐานผลิตภัณฑ์อุตสาหกรรม พ.ศ. 2511



ประกาศกระทรวงอุตสาหกรรม

ฉบับที่ 4156 (พ.ศ. 2552)

ออกตามความในพระราชบัญญัติมาตรฐานผลิตภัณฑ์อุตสาหกรรม

พ.ศ. 2511

เรื่อง กำหนดมาตรฐานผลิตภัณฑ์อุตสาหกรรม

ตัวยึด - รอยความไม่ต่อเนื่องที่ผิว

เล่ม 3 สลักเกลียว หมุดเกลียวและสลักเกลียวปล่อยสองข้างสำหรับใช้งานพิเศษ

อาศัยอำนาจตามความในมาตรา 15 แห่งพระราชบัญญัติมาตรฐานผลิตภัณฑ์อุตสาหกรรม พ.ศ. 2511 รัฐมนตรีว่าการกระทรวงอุตสาหกรรมออกประกาศกำหนดมาตรฐานผลิตภัณฑ์อุตสาหกรรม ตัวยึด - รอยความไม่ต่อเนื่องที่ผิว เล่ม 3 สลักเกลียว หมุดเกลียวและสลักเกลียวปล่อยสองข้างสำหรับใช้งานพิเศษ มาตรฐานเลขที่ มอก. 2457 เล่ม 3-2552 ไว้ ดังมีรายละเอียดต่อท้ายประกาศนี้

ประกาศ ณ วันที่ 29 ธันวาคม พ.ศ. 2552

ชาญชัย ชัยรุ่งเรือง

รัฐมนตรีว่าการกระทรวงอุตสาหกรรม

มาตรฐานผลิตภัณฑ์อุตสาหกรรม

ตัวยึด - รอยความไม่ต่อเนื่องที่ผิว

เล่ม 3 สลักเกลียว หมุดเกลียวและสลักเกลียวปล้อยสองข้าง สำหรับใช้งานพิเศษ

บทนำ

มาตรฐานผลิตภัณฑ์อุตสาหกรรมนี้กำหนดขึ้นโดยรับ ISO 6157-3:1988 Fasteners – Surface discontinuities – Part 3: Bolts, screws and studs for special requirements มาใช้ในระดับเหมือนกันทุกประการ (identical) โดยใช้ ISO ฉบับภาษาอังกฤษเป็นหลัก

ขอบข่าย

- 1.1 มาตรฐานผลิตภัณฑ์อุตสาหกรรมนี้ กำหนดขีดจำกัดสำหรับรอยความไม่ต่อเนื่องที่ผิวชนิดต่าง ๆ ของสลักเกลียว หมุดเกลียว และ สลักเกลียวปล้อยสองข้างสำหรับใช้ในงานพิเศษ
มาตรฐานผลิตภัณฑ์อุตสาหกรรมนี้ ใช้กับสลักเกลียว หมุดเกลียวและสลักเกลียวปล้อยสองข้าง ซึ่ง
 - เส้นผ่านศูนย์กลางเกลียวระบุตั้งแต่ 5 มิลลิเมตร ขึ้นไป
 - ผลิตภัณฑ์ชั้น A และ B
 - ความยาวระบุ l น้อยกว่าหรือเท่ากับ $10 d$ (หรือมากกว่าหากมีการระบุ)
 - ชั้นสมบัติ 12.9
 - ชั้นสมบัติ 8.8 , 9.8 และ 10.9 หากมีการระบุในมาตรฐานผลิตภัณฑ์หรือในการตกลงระหว่างผู้ส่งมอบและผู้ซื้อ
- 1.2 เมื่อเกิดรอยความไม่ต่อเนื่องที่ผิวตามขีดจำกัดที่ยอมรับได้ตั้งระบุในข้อ 3 ค่าสมบัติทางกลและค่าการใช้งานต่ำสุดจะต้องเป็นไปตามที่ระบุใน ISO 898-1
เมื่อระบุข้อกำหนดความต้านการล้า ค่าความต้านการล้าจะต้องไม่ต่ำกว่าค่าที่ได้จากการทดสอบสลักเกลียวซึ่งไม่มีรอยความไม่ต่อเนื่องจากเริ่มต้นเดียวกัน

หมายเหตุ

1. รูปในข้อ 3 เป็นเพียงตัวอย่างซึ่ง สามารถนำมาใช้กับ สลักเกลียว หมุดเกลียวและสลักเกลียวปล้อยสองข้าง ชนิดอื่น ๆ ในลักษณะเช่นเดียวกัน
2. ในแต่ละรูปแสดงรอยความไม่ต่อเนื่องที่ผิวแบบเกินความจริงเพื่อให้เกิดความชัดเจน

เอกสารอ้างอิง

เอกสารอ้างอิงที่ระบุต่อไปนี้จะประกอบกับมาตรฐานผลิตภัณฑ์อุตสาหกรรมนี้ เอกสารอ้างอิงฉบับที่ระบุปีที่พิมพ์ให้ใช้ฉบับที่ระบุ ส่วนเอกสารที่ไม่ระบุปีที่พิมพ์นั้นให้ใช้ฉบับล่าสุด (รวมถึงฉบับแก้ไขเพิ่มเติม)

ISO 468, *Surface roughness – Parameters, their values and general rules for specifying requirements.*

ISO 898-1, *Mechanical properties of fasteners – Part 1: Bolts, screws and studs.*

ISO 2859, *Sampling procedures and tables for inspection by attributes.*

ISO 3269, *Fasteners – Acceptance inspection.*

ชนิด สาเหตุ ลักษณะปรากฏทั่วไป และขีดจำกัดของรอยความไม่ต่อเนื่องที่ผิว

มาตรฐานผลิตภัณฑ์อุตสาหกรรมนี้กำหนดชนิด สาเหตุ ลักษณะปรากฏทั่วไป และขีดจำกัดของรอยความไม่ต่อเนื่องที่ผิว รายละเอียดตาม ISO 6157-3:1988 ข้อ 3

วิธีการตรวจสอบและประเมินผล

มาตรฐานผลิตภัณฑ์อุตสาหกรรมนี้กำหนดวิธีการตรวจสอบและประเมินผล รายละเอียดตาม ISO 6157-3:1988 ข้อ 4

ภาคผนวก

แผนการชักตัวอย่างสำหรับการตรวจสอบรอยความไม่ต่อเนื่องที่ผิว

มาตรฐานผลิตภัณฑ์อุตสาหกรรมนี้กำหนด แผนการชักตัวอย่างสำหรับการตรวจสอบรอยความไม่ต่อเนื่องที่ผิว รายละเอียดตาม ISO 6157-3:1988 Annex

© ISO 1988

เอกสารนี้เป็นสิทธิ์ของ ISO หากมิได้กำหนดไว้เป็นอย่างอื่นห้ามนำมาตรฐานฉบับนี้หรือ
ส่วนหนึ่งส่วนใดไปทำซ้ำหรือใช้ประโยชน์ในรูปแบบ หรือโดยวิธีใด ๆ ไม่ว่าจะเป็นรูปแบบ
อิเล็กทรอนิกส์หรือทางกล รวมถึงการถ่ายสำเนา ถ่ายไมโครฟิล์ม โดยไม่ได้รับอนุญาตเป็น
ลายลักษณ์อักษรจาก ISO ตามที่อยู่ข้างล่างหรือจากสมาชิก ISO ในประเทศของผู้ร้องขอ

ISO copyright office

Case postale 56 • CH-1211 Geneva 20

Tel.+ 41 22 749 01 11

Fax+ 41 22 749 09 47

E-mail : copyright@iso.org

Web : www.iso.org

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

Draft International Standards adopted by the technical committees are circulated to the member bodies for approval before their acceptance as International Standards by the ISO Council. They are approved in accordance with ISO procedures requiring at least 75 % approval by the member bodies voting.

International Standard ISO 6157-3 was prepared by Technical Committee ISO/TC 2, *Fasteners*.

Users should note that all International Standards undergo revision from time to time and that any reference made herein to any other International Standard implies its latest edition, unless otherwise stated.

Fasteners — Surface discontinuities —

Part 3: Bolts, screws and studs for special requirements

1 Scope and field of application

1.1 This part of ISO 6157 establishes limits for various types of surface discontinuities on bolts, screws and studs for special requirements.

It applies to bolts, screws and studs with

- nominal thread diameters 5 mm and larger;
- product grades A and B;
- nominal lengths $l \leq 10d$ (or longer if specified);
- property class 12.9;
- property classes 8.8, 9.8 and 10.9 when specified in product standards or agreed between supplier and purchaser.

1.2 Where the permissible limits for surface discontinuities indicated in clause 3 occur, the minimum values for the mechanical and functional properties specified in ISO 898-1 should still be met.

When fatigue strength requirements are specified, the fatigue strength should not be lower than that obtained on bolts without defects taken from the same lot.

NOTES

1 The figures in clause 3 are examples only. They apply correspondingly also to other types of bolts, screws and studs.

2 The individual figures show the surface discontinuities exaggerated in some cases for clarity.

2 References

ISO 468, *Surface roughness — Parameters, their values and general rules for specifying requirements.*

ISO 898-1, *Mechanical properties of fasteners — Part 1: Bolts, screws and studs.*

ISO 2859, *Sampling procedures and tables for inspection by attributes.*

ISO 3269, *Fasteners — Acceptance inspection.*

3 Types, causes, appearance and limits of surface discontinuities

3.1 Cracks

A crack is a clean (crystalline) fracture passing through or across the grain boundaries and may possibly follow inclusions of foreign elements. Cracks are normally caused by overstressing the metal during forging or other forming operations, or during heat treatment. Where parts are subjected to significant reheating, cracks usually are discoloured by scale.

3.1.1 Quench cracks

Cause	Quench cracks may occur during hardening due to excessively high thermal and transformation stresses. Quench cracks usually follow an irregular and erratic course on the surface of the fastener.
Appearance	<p>Quench crack circumferential and adjacent to fillet</p> <p>Quench crack at corner of head</p> <p>Transverse quench crack</p> <p>Quench crack at root</p> <p>Quench crack, section at crest of thread missing</p> <p>Quench crack across top of head. Usually an extension of crack in shank or side of head</p> <p>A</p> <p>Quench crack across washer face and to depth of washer face thickness</p> <p>Longitudinal quench crack</p> <p>Quench crack extending radially into fillet</p> <p>A-A</p> <p>Quench crack, at root</p> <p>Quench crack</p>
Limits	Quench cracks of any depth, any length, or in any location are not permitted.

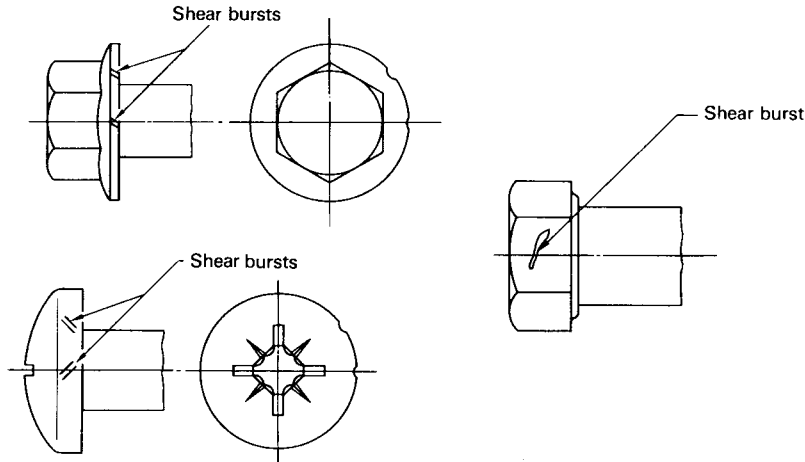
3.1.2 Forging cracks

Cause	Forging cracks may occur during the cut-off or forging operations and are located on the top of the head of screws and bolts.
Appearance	<p>Forging crack on top of head</p>
Limits	<p>Length, l, of forging cracks: $l \leq d^{1)}$</p> <p>Depth or width, b, of forging cracks: $b \leq 0,04d$</p> <p>NOTE — The limits for forging cracks do not apply to socket head screws (see 3.1.5).</p> <p>1) d = nominal thread diameter</p>



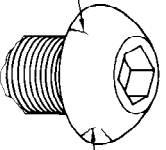

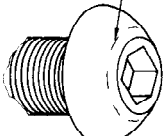
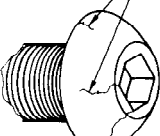
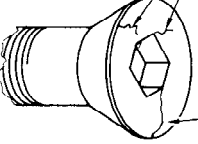
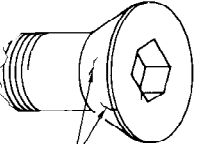
3.1.3 Forging bursts

Cause	Forging bursts may occur for example during forging on the flats or corners of the heads of bolts and screws, at the periphery of flanged or circular head products or on the raised periphery of indented head bolts and screws.
Appearance	
Limits	<p>Hexagon head screws</p> <p>No forging burst in the flats of hexagon bolts and screws shall extend into the crown circle on the top of the head surface (chamfer circle) or into the underhead bearing surface. Forging bursts occurring at the intersection of two wrenching flats shall not reduce the width across corners below the specified minimum.</p> <p>Forging bursts in the raised periphery of indented head bolts and screws shall not exceed a width of $0,06d^{(1)}$ or have a depth extending below the indented portion.</p> <p>Circular head screws</p> <p>Flanges of bolts and screws and peripheries of circular head screws may have forging bursts, but they shall not exceed the following limits:</p> <p>Width of forging bursts:</p> <p>$0,08d_c^{(2)}$ (with only one forging burst);</p> <p>$0,04d_c$ (with two or more forging bursts, one of which may extend to $0,08d_c$).</p> <p>Depth of forging bursts:</p> <p>$0,04d^{(1)}$</p> <p>1) d = nominal thread diameter</p> <p>2) d_c = head or flange diameter</p>

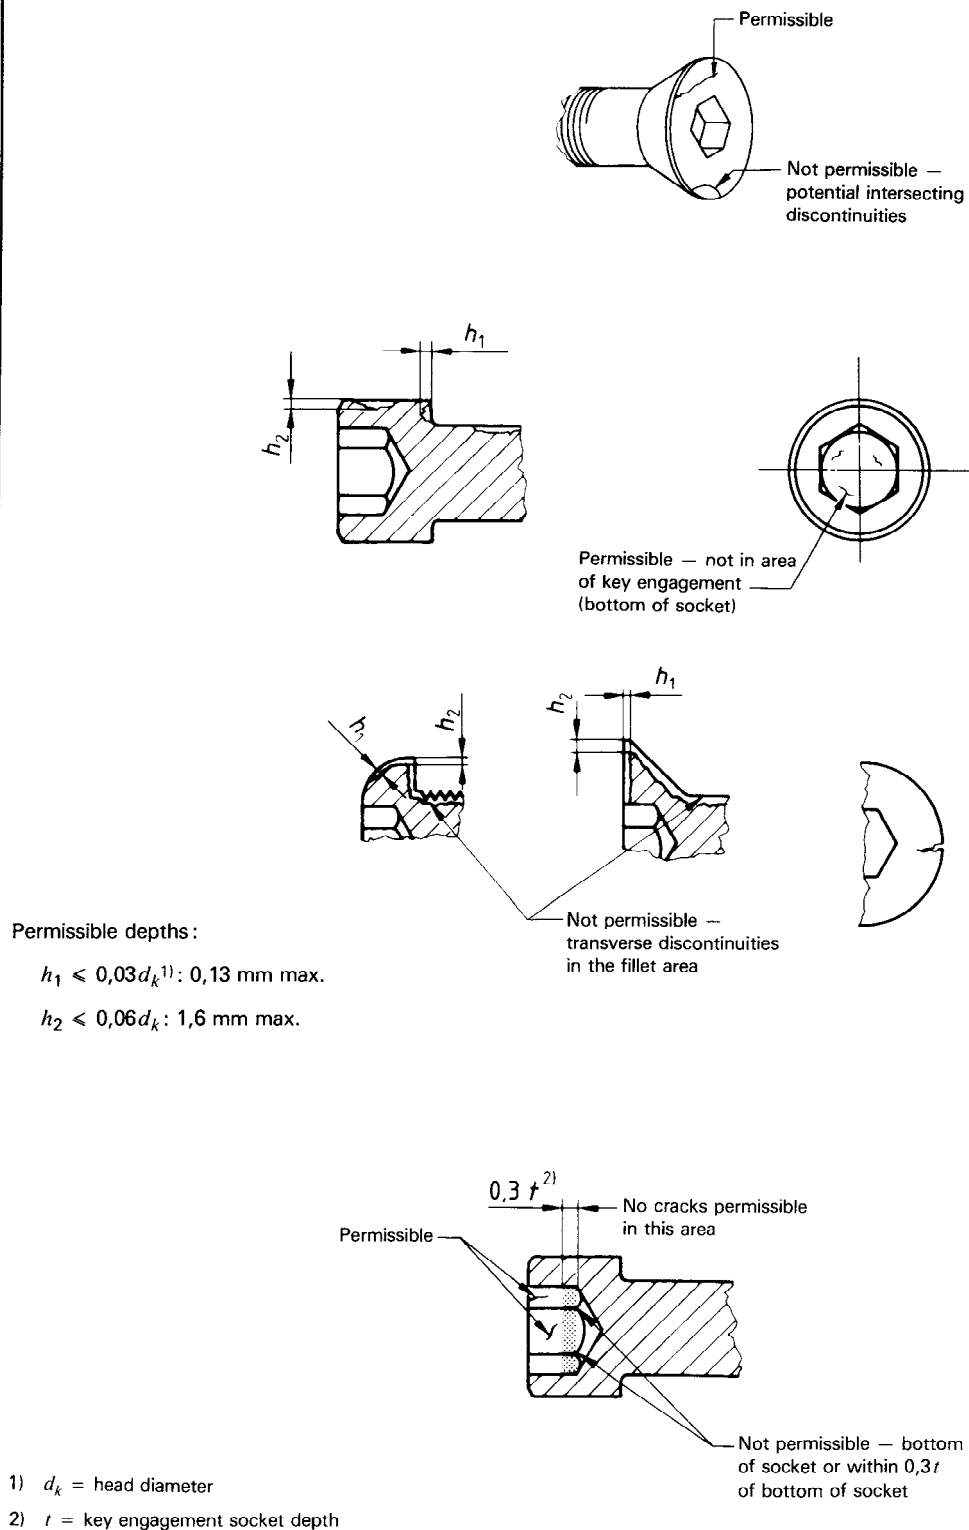
3.1.4 Shear bursts

Cause	<p>Shear bursts may occur, for example during forging, frequently at the periphery of products having circular or flanged heads, and are located at approximately 45° to the product axis.</p> <p>Shear bursts may also occur on the sides of hexagon head products.</p>
Appearance	
Limits	<p>Hexagon head screws</p> <p>Shear burst limits on the wrenching head are as follows:</p> <p>Width $< 0,25 \text{ mm} + 0,02s^{1)}$</p> <p>Depth $< 0,04d$</p> <p>No shear burst in the flats of hexagon bolts and screws shall extend into the crown circle on the top of the head surface (chamfer circle) or into the underhead bearing surface. Shear bursts, occurring at the intersection of two wrenching flats, shall not reduce the width across corners below the specified minimum.</p> <p>Shear bursts in the raised periphery of indented head bolts and screws shall not exceed a width of $0,06d^{2)}$ or have a depth extending below the indented portion.</p> <p>Circular head screws</p> <p>Flanges of bolts and screws and peripheries of circular head products may have shear bursts, but shall not exceed the following limits:</p> <p>Width of shear bursts:</p> <p>$0,08d_c^{3)}$ (for only one shear burst);</p> <p>$0,04d_c$ (with two or more forging shear bursts, one of which may extend to $0,08d_c$).</p> <p>1) s = width across flats 2) d = nominal thread diameter 3) d_c = head or flange diameter</p>

3.1.5 Forging cracks in socket head screws

Cause	Cracks in the periphery, in the top surface and on the indented portion (hexagon socket) may occur on the inner and outer faces due to cut-off of wire section, shear and compressive stress during forging operations and countersinking of head.
Appearance	<div><p>Permissible — does not extend more than half the distance between the periphery of the head and the socket</p><p>Not permissible — connects socket and edge of head</p><p>Not permissible — potential intersecting discontinuities</p><p>Not permissible</p><p>Not permissible — connects socket and edge of head</p></div>

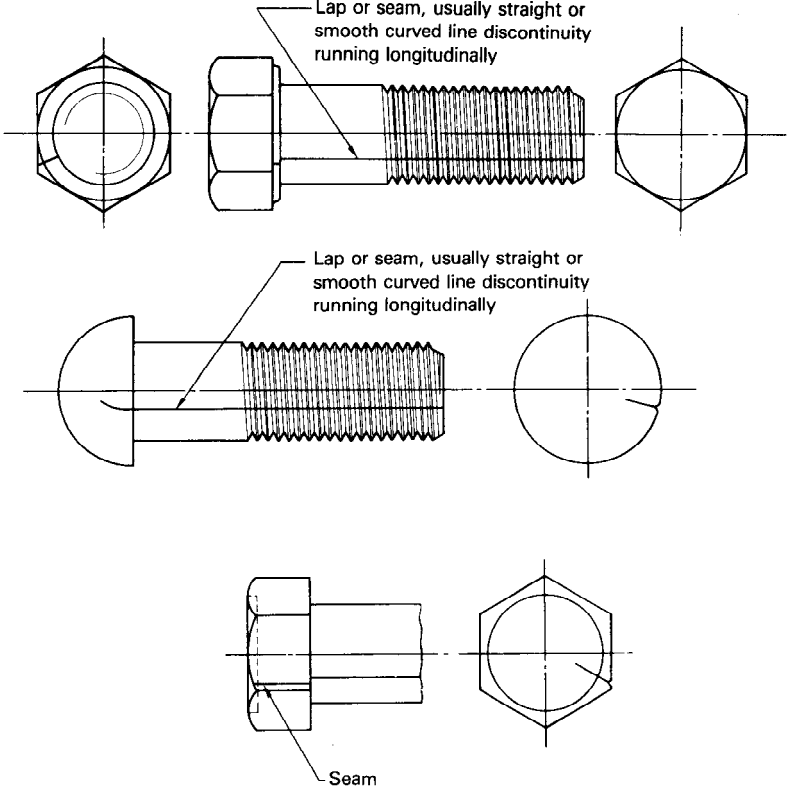
Appearance
(continued)



Limits	<p>Cracks extending from the socket to the outer face and cracks with a traverse indicating a potential to intersect are not permissible. Cracks within $0,3t$ of the bottom of the socket are not permissible. Cracks located elsewhere in the socket are permissible, provided that they do not exceed a length of $0,25t$ and a depth of $0,03d_k$ (0,13 mm max.).</p> <p>One crack in the longitudinal direction with a depth not exceeding $0,03d_k$ (0,13 mm max.) at the head/shank intersection and on the top of the head is permissible. Longitudinal cracks with a depth not exceeding $0,06d_k$ (1,6 mm max.) located in the periphery are permissible.</p>
---------------	--

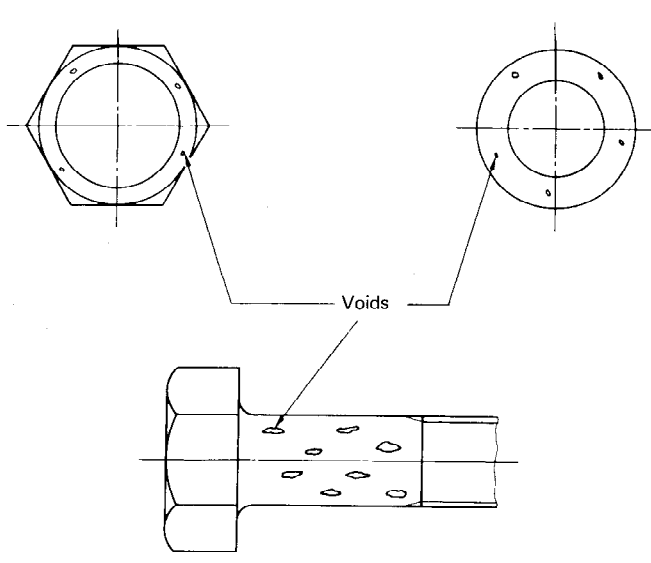
3.2 Raw material seams and laps

A seam or lap is a narrow, generally straight or smooth curved line discontinuity running longitudinally on the thread, shank or head.

Cause	Seams and laps are inherent in the raw material from which fasteners are made.
Appearance	
Limits	<p>Permissible depth : $0,015d^{(1)} + 0,1$ mm : 0,4 mm max.</p> <p>If laps or seams extend into the head, they shall not exceed the permissible limits for width and depth specified for bursts (see 3.1.3).</p> <p>1) d = nominal thread diameter</p>

3.3 Voids

A void is a shallow pocket or hollow on the surface of a bolt or screw due to non-filling of metal during forging or upsetting.

Cause	Voids are produced by marks and impressions due to chips (shear burrs) or by rust formation on the raw material. They are not eliminated during forging or upsetting operations.
Appearance	
Limits	<p>Depth, h, of voids:</p> $h < 0,02d^{1)}: 0,25 \text{ mm max.}$ <p>Area of all voids:</p> <p>The combined surface area of all voids on the bearing face shall not exceed 5 % of the total area.</p> <p>1) d = nominal thread diameter</p>

3.4 Folds

A fold is a doubling over of metal which occurs at the surface of the fastener during forging.

Cause	Folds are produced by material displacements due to lack of congruence of forms and volumes of the single forging steps.
Appearance	
Limits	<p>Folds at interior corners at or below the bearing surface are not permissible, unless specifically permitted in this part of ISO 6157 or in the product standard.</p> <p>Folds at exterior corners are permissible.</p>

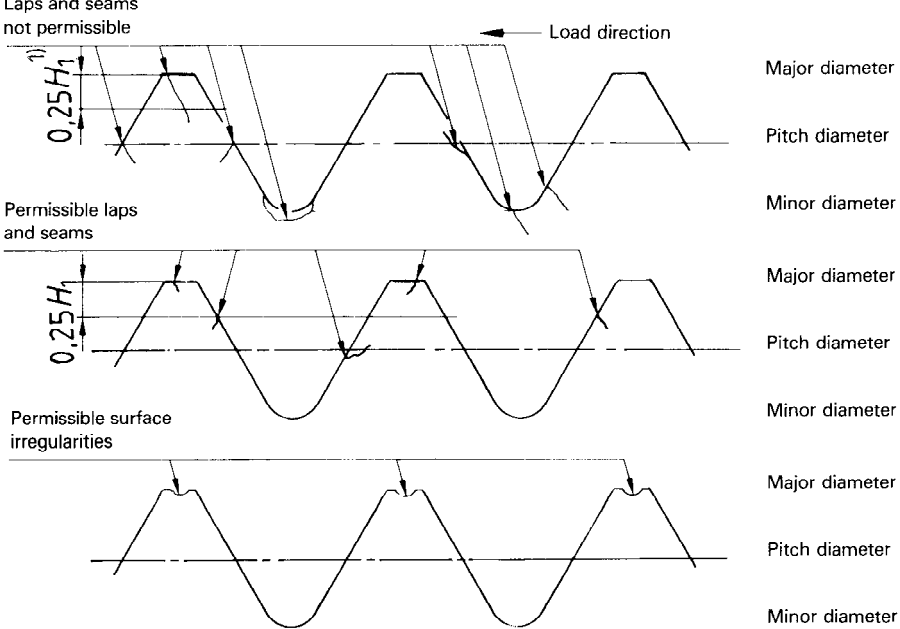
3.5 Tool marks

Tool marks are longitudinal or circumferential grooves of shallow depth.

Cause	Tool marks are produced by the movement of manufacturing tools over the surface of the bolt or screw.
Appearance	
Limits	Tool marks produced by machining in the shank, fillet or bearing surface shall not exceed a surface roughness of $R_a = 3,2 \mu m$ when tested in accordance with ISO 468.

3.6 Laps on the thread

A lap is a fold-over of metal in the thread. Laps generally show a pattern of consistency between the same product, that is laps will be identically located and with the same direction of traverse between all products.

Cause	Folds and laps on the thread occur during cold-forming of the thread by rolling.
Appearance	 <p>1) H_1 = depth of thread</p>
Limits	<p>Laps of any depth or length are not permitted in the following places:</p> <ul style="list-style-type: none"> — at the root of the thread; — at the loaded flank of screw thread below the pitch diameter, even if they start beyond the pitch diameter. <p>The following laps are permissible:</p> <ul style="list-style-type: none"> — laps in the crest of the threads of $0,25 H_1$ max.; — crest of the threads not entirely rolled out, maximum half a turn on one thread; — laps below the pitch diameter, if they run on the non-loaded flank towards the major diameter and not deeper than $0,25 H_1$ and not longer than half a turn on one thread.

3.7 Damages

Damages are indentations of any surface of a bolt or screw.

Cause	Damages, for example dents, scrapes, nicks and gouges, are produced by external action during manufacture and handling of bolts and screws, for example during loading.
Appearance	No precise geometrical shape, location or direction, identifiable as external action.
Limits	<p>Damages as described above shall not cause rejection unless it can be shown that they impair function or usability.</p> <p>Dents, scrapes, nicks and gouges on the first three threads shall be such that they allow the screwing on of a go-ring gauge with torque values of $0,001 d^3$ max., in newton metres.</p> <p>A specific agreement on packaging, for example, may be necessary in order to avoid damage during transport.</p>

Table 1 — Permissible surface discontinuities

Dimensions in millimetres

Clause	3.1.2		3.1.3		3.1.4		3.1.5				3.2	3.3	3.6	3.7
Defect	Forging cracks		Forging bursts		Shear bursts		Cracks on hexagon socket screws				Laps	Voids	Laps in threads	Damages
Nominal thread diameter, <i>d</i>	Length max.	Depth and width max.	Width max.	Depth max.	Width max.	Depth max.	Socket		Head		Raw material Depth max.	Depth max.	Depth max.	Torque value N · m max.
							Length max.	Depth max.	Faces Depth max.	Edges (round) Depth max.				
5	5	0,2	0,08 × head or flange diameter or 0,04 × head or flange diameter	0,2	0,25 mm + 0,02s for wrenching surfaces 0,08 × head or flange diameter or 0,04 × head or flange diameter	0,2	0,25 × depth of socket	0,13	0,03 × head diameter or 0,13 mm whichever is larger	0,06 × head diameter not more than 1,6 mm	0,17	0,1	0,11	0,125
6	6	0,24		0,24		0,24		0,13			0,19	0,12	0,14	0,22
7	7	0,28		0,28		0,28		0,13			0,21	0,14	0,14	0,33
8	8	0,32		0,32		0,32		0,13			0,22	0,16	0,17	0,51
10	10	0,4		0,4		0,4		0,13			0,25	0,2	0,2	1
12	12	0,48		0,48		0,48		0,13			0,28	0,24	0,24	1,73
14	14	0,56		0,56		0,56		0,13			0,31	0,25	0,27	2,7
16	16	0,64		0,64		0,64		0,13			0,34	0,25	0,27	4,1
18	18	0,72		0,72		0,72		0,13			0,37	0,25	0,34	5,8
20	20	0,8		0,8		0,8		0,13			0,4	0,25	0,34	8
22	22	0,88		0,88		0,88		0,13			0,4	0,25	0,34	10,6
24	24	0,96		0,96		0,96		0,13			0,4	0,25	0,41	13,8
27	27	1,1		1,1		1,1		0,13			0,4	0,25	0,41	19,7
30	30	1,2		1,2		1,2		0,13			0,4	0,25	0,47	27
33	33	1,3		1,3		1,3		0,13			0,4	0,25	0,47	35,9
36	36	1,4		1,4		1,4		0,13			0,4	0,25	0,54	46,6
39	39	1,6		1,6		1,6		0,13			0,4	0,25	0,54	59,3

4 Inspection and evaluation procedure

For the acceptance inspection procedure, see ISO 3269. Surface coatings shall be removed before examination if identification of the surface discontinuities is impaired.

NOTE — The 1984 edition of ISO 3269 gives no specifications on sampling plans for surface discontinuities of fasteners. Until this has been completed, the applicable sampling plan is given in the annex.

4.1 Principles

The manufacturer is entitled to use any inspection procedures but due care shall be taken to ensure that products conform to this part of ISO 6157.

The purchaser may use the inspection procedure specified in this clause at his acceptance inspection in order to decide whether a lot of fasteners may be accepted or rejected. This procedure shall also be applied when conformance to specification is disputed, unless some other acceptance procedure has been agreed between the manufacturer and the purchaser at the time of ordering the fasteners.

4.2 Non-destructive testing

A random sample shall be taken from the lot in accordance with table 2 in the annex and subjected to either visual tests or other

suitable tests, e.g. magnetic techniques or eddy current. If no defective product is found the lot shall be accepted (see also 4.4). If defective products are found these shall form the lot size for the procedures given in 4.3.

4.3 Destructive testing

If defective products are detected by the procedures given in 4.2, then a secondary sample shall be taken from the defective products, in accordance with table 3 in the annex, consisting of the products indicating the most serious defects and sectioned at 90° through the discontinuity where the greatest depth is expected.

4.4 Evaluation

If on visual inspection any product is found with quench cracks in any location, or folds at interior corners or below the bearing surface, except "clover leaf" folds in non-circular shoulder fasteners, the lot shall be subject to rejection.

If on the destructive test any product is found with forging cracks, bursts, seams and laps, voids, tool marks or damages which exceed the allowable limits as specified for the applicable type of discontinuity, the lot shall be subject to rejection.

Annex

Sampling plan for surface discontinuities

(This annex forms an integral part of this standard.)

Sampling for surface discontinuities shall be carried out using the sample sizes given in table 2 and using the principles and procedures given in clause 4.

Table 2 — Sample sizes for visual and non-destructive testing

Lot size ¹⁾ N	Sample size n
$N < 1\ 200$	20
$1\ 201 < N < 10\ 000$	32
$10\ 001 < N < 35\ 000$	50
$35\ 001 < N < 150\ 000$	80

1) Lot size is the number of products of the same type, size and property class submitted for inspection at one time.

NOTE — The sample sizes are based on special inspection level S-4 specified in ISO 2859.

Table 3 — Secondary sample sizes for destructive testing

Number of defective products in the sample N	Secondary sample size n
$N < 8$	2
$9 < N < 15$	3
$16 < N < 25$	5
$26 < N < 50$	8
$51 < N < 80$	13

NOTE — The secondary sample sizes are based on general inspection level II specified in ISO 2859.